



40A High Power Straight DIP Solder Combination D-Sub


21W4 (Plug Connector)

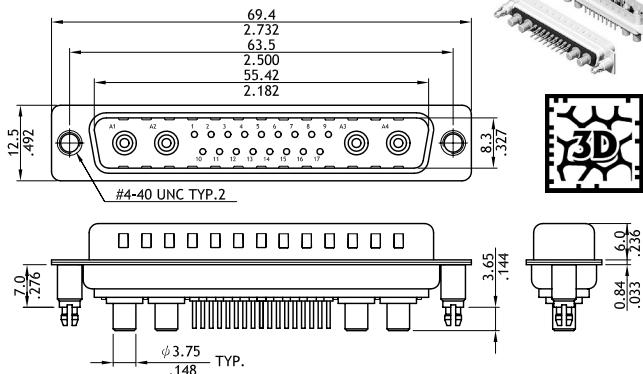


21W4 (Receptacle Connector)

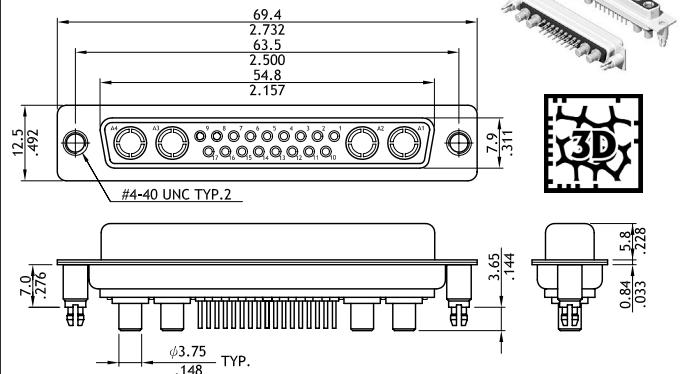


25W3 (Plug Connector)

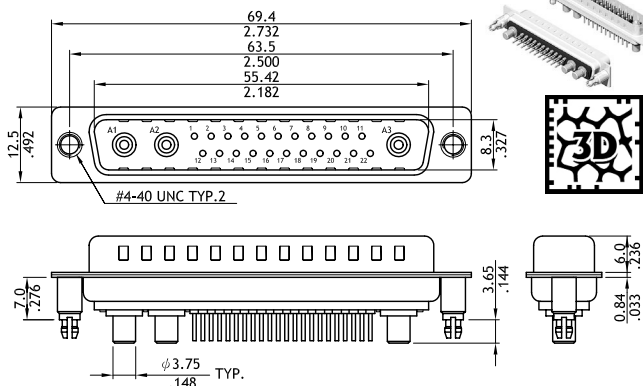


25W3 (Receptacle Connector)

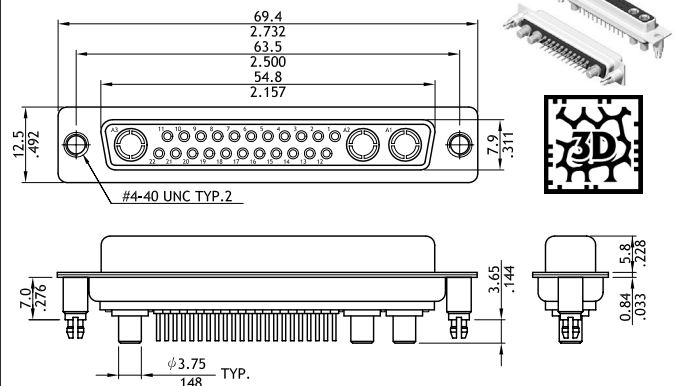

36W4 (Plug Connector)

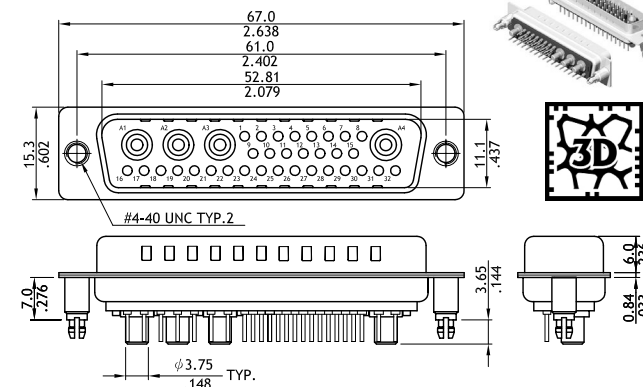

36W4 (Receptacle Connector)

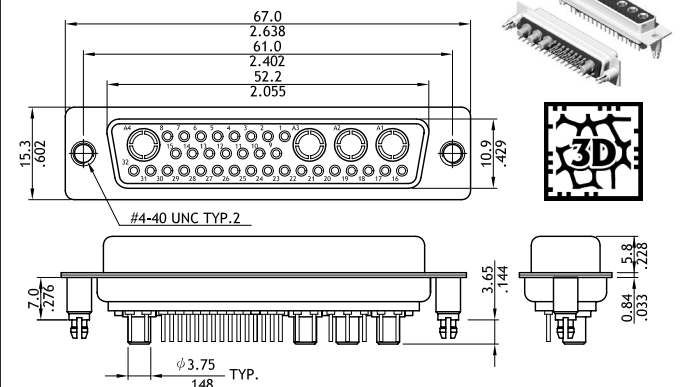

Ordering Code

① I 3 W 3 ② S ③ P ④ V ⑤ 2 ⑥ 2 ⑦ 1 ⑧ 4 0 ⑨ D 0 0

① Series No.: C3W3,3W3C,C7W2,11W1,C5W5,13W3
17W3,C8W8,21W4,25W3,36W4

② Connector Type: P = Plug
S = Receptacle

③ Contact Type: P = High Power Contact

④ Contact Tail Style: V = Straight DIP Type

⑤ High Power Contact Plating: 2 = Gold flash over Nickel

⑥ Signal Contact Plating: 2 = Gold flash over Nickel
0 = Without Signal Contact

⑦ Insulator Color: 1 = Black

⑧ Performance: 40 = 40A

⑨ Mounting Style:

000 = With $\phi 3.05$ mm holes on shell

A00 = Riveted #4-40 UNC Close nuts on Front shell

B00 = Riveted #4-40 UNC Open nuts on Front shell

C00 = Riveted #4-40 UNC Open nuts on Rear shell

D00 = Riveted #4-40 UNC Ground Stand-off (Standard)

*Special options consult manufacturer